

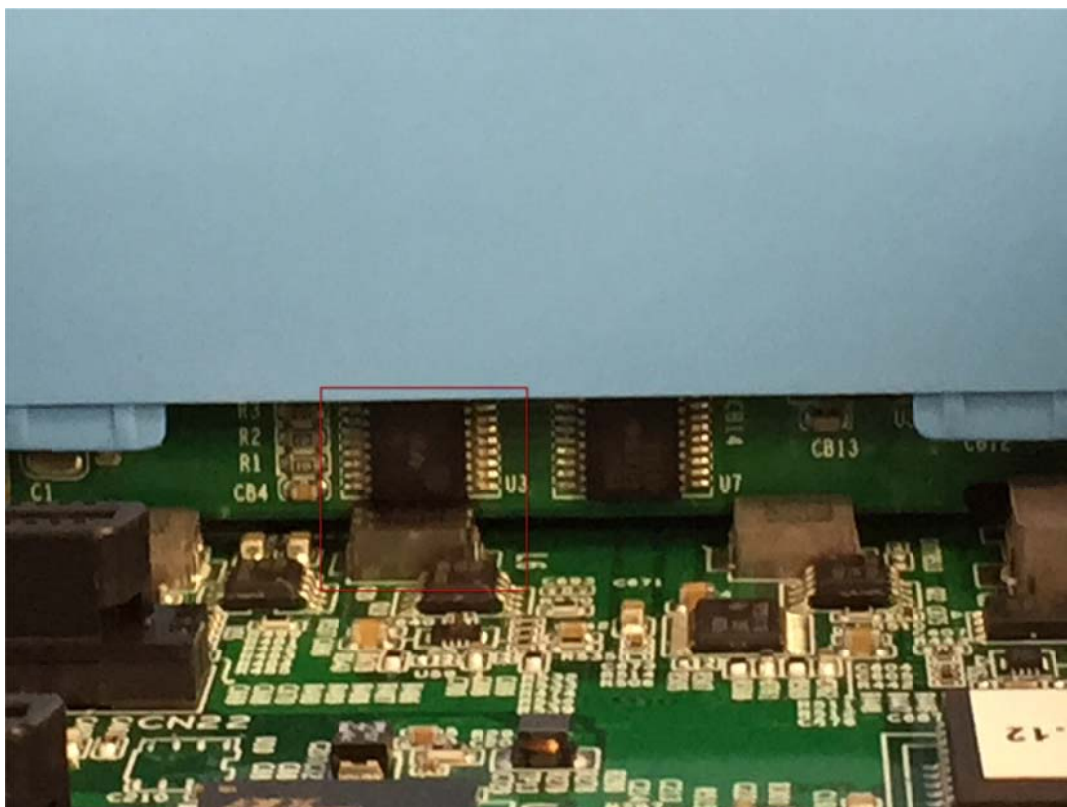
Data Create	2015/03/23	Release Note	<input type="checkbox"/> Internal <input checked="" type="checkbox"/> External
Category	FAQ	Product Group	IAG
Function	Notification	Related OS	Win XPE & WinCE
Related Product	ADAM-5053S & ADAM-5560		

[Abstract]

Older ADAM-5053S can't be inserted in the slot 0 of ADAM-5560 because of the components interference problem of ADAM-5053S and ADAM-5560.

[Problem]

1. If you plug the older ADAM-5053S on the slot 0 position of ADAM-5560, the component "U3" on the older ADAM-5053S will be broken by the component "L6" on ADMA-5560 backplane.

**[Solution]**

1. Don't plug the older ADAM-5053S on the slot0 of ADAM-5560.
2. The ECOM-106401 of ADAM-5053S that modifies the U3/U4 location will be imported.